


# Troubleshooting Guide


## E26 STILL ANODE ERROR

**No ROTOR Current Sense during PREP.**

1. Confirm X-Ray Tube stator connections and stator resistance.

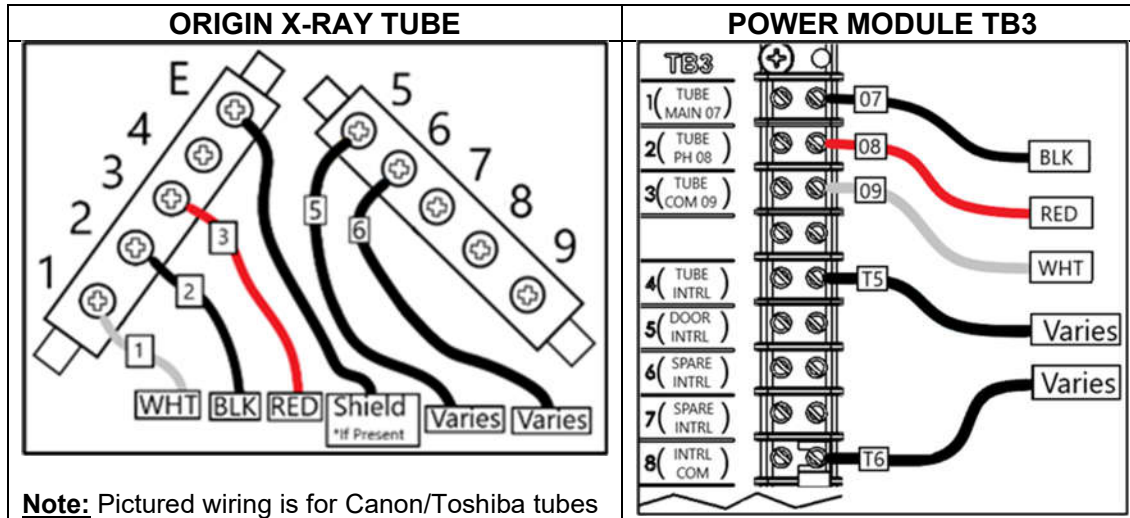

2. Check chassis fuses F13 & F14 @ FB2 (Fuse Bank 2)
3. Confirm if AUX CAPACITOR (PHASE SHIFT CAP) is disconnected or needing replacement. Chassis C10 capacitor is located on the FRONT RIGHT corner.
4. Check ROTOR SENSE BOARD (K444-00) for failure. (Left of the C10 capacitor)
5. Check if K2 (SSR) rotor module is triggering and delivering power during PREP.
6. Check SYSTEM CONTROLLER BOARD for H8 & H9 header connections not crossed.

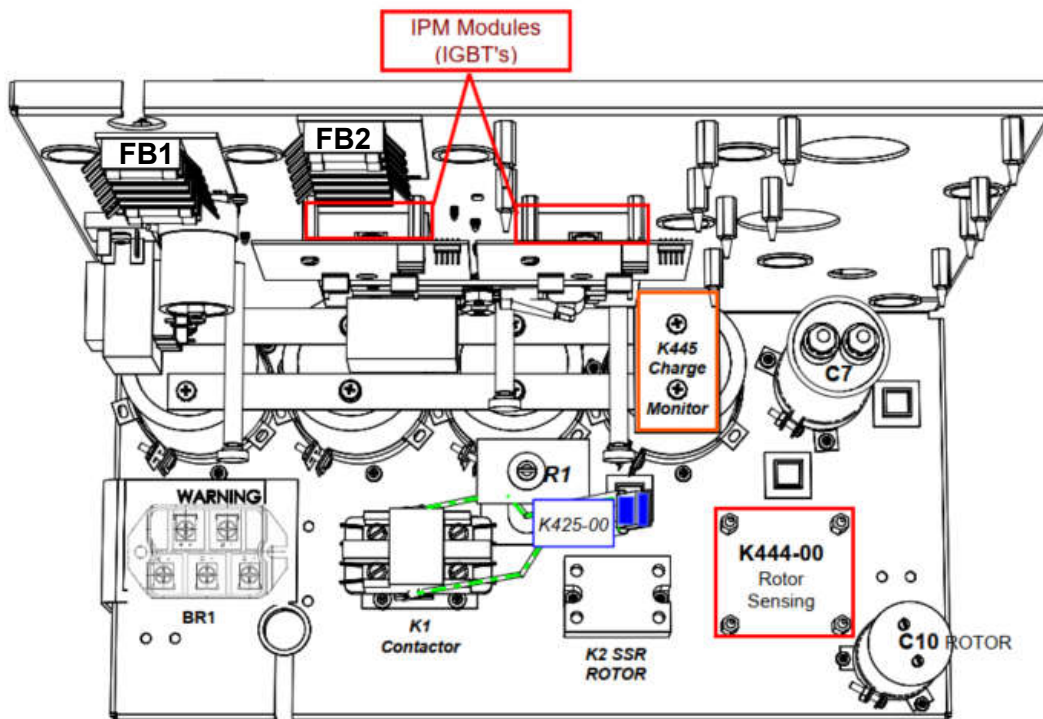

TOP VIEW CHASSIS